



Ragchew

"The Voice of Branch 68"

November 2017

The North Canterbury Amateur Radio Club Inc.
PO Box 14, Woodend 7641



www.ncarcinc.weebly.com



Meetings are held at the Woodend Youth Centre, unless otherwise advised.

QTH

CLUB CALENDAR

Meetings start at 1930hrs, unless otherwise stated.

Host for November - ZL3HAM

Branch 68

November 9 General Meeting

Branch 01 Ashburton

November 13 General Meeting

Branch 05 Christchurch

November 1 General Meeting

November 16 Day Meeting @ 1300hrs

CARDS

November 15 Regular Meeting

News Flash

NCARCInc Christmas cake to be baked ready for consumption on December 14th at the general meeting breakup in Woodend, make a note in your calendar. See you there.

DX Contest

CQ Worldwide DX Contest, CW 0000Z, Nov 25 to 2400Z, Nov 26. Get ready

Nets and Frequencies

Canterbury 2M SSB Net 144.200MHz every Tuesday from 2000hrs (vertical polarisation)

Canterbury 6M Net 3850 6M Repeater Thursdays from 2000hrs (vertical polarisation)

Canterbury Area Net 5625 Repeater, 2000hrs on Sundays

National Broadcast last Sunday of the month at 2000hrs on 3.900MHz, National System, 6975 and 705 Repeaters

Secretary: Colin Rowe ZL3COL **Phone** 03 313 2303 **Email:** colingr@xtra.co.nz

Editor: Ron Kautz ZL3RCK **Phone** 021 036 7315 **Email:** zl3rck@gmail.com

BAYLEYS

WHALAN AND PARTNERS LTD, BAYLEYS, LICENSED UNDER THE REA ACT 2008.

Thanks to **BAYLEYS** for sponsoring the photocopying of the newsletter.

Tel: 03 311 8020

Presidents Report Nov 2017

Monday, 30 October 2017

15:06

As I sit here writing this report it feels like summer has finally arrived.

At the next meeting we will discuss the future of our Mount Noble repeater and present the recommendation of the committee. If you have an opinion on this topic, come along and have your say.

On a more personal note I have been dipping my toe into the JT/FT digital modes and am finding them quite interesting and certainly worth a look if you're interested in low signal working. More on this at a later time.

At the last ham cram at Br 05 another 8 amateurs successfully completed their Amateur radio operators certificate of competency, so look out for these new chums on the bands, and give them a warm welcome to the hobby.

See you on the 16th

Don Macdonald
ZL3DMC

AREC / FIRE Reports

Forest Rural Fire: (AREC supplied Comms / Logistics to Forestry Fire Teams).

Fri. 20/10/17 Assistance call to a rural fire near Ashley Forest. First arrival (Rangiora) found fire to be a permitted burn and no action required. The Forestry Fire unit arrived shortly after and were then stood down.



Geoff ZL3QR

Repeater Reports

Mount Grey 675 (146.750Mhz) Repeater

A very strong, spasmodic interference appeared on September 14th and has been of varying intensity most days since. Progress is being made regarding locating the source of this interference.



Mount Noble 6975 (146.975Mhz) Repeater

This repeater was shut down for two 4-day periods in an effort to try and give the batteries a chance to recover from an extended period of low winds and continuous cloud cover. Unfortunately, the battery voltage remains abnormally low which is giving concerns of possible battery and/or charging system failure. The current batteries are now 8 years old and this is their expected life span. Because of the difficult access to this repeater there has been no maintenance carried out for some years so although the repeater is still operational for now, the true condition of all the equipment is unknown.



Taking into consideration the lack of use this repeater now gets and it's current condition, a decision on it's future needs to be confirmed.

Geoff ZL3QR.

Read more from Geoff on the current situation of the Mount Noble 6975 repeater on the next page.

Mt. Noble 6975 – The Current Situation.

(For the full history of this Repeater, please refer to the Club's website).

At the time that this Repeater came into being in 1994 there were a small number of “radio hams” living north of the Weka Pass, an area where the Christchurch based repeaters failed to reach satisfactorily. Our Club had been running Radio Classes in the Hawarden / Waikari area and in due course the radio ham population would increase a bit more, some who also had a considerable interest in the Lakes area as well. This was the reason for locating 6975 on Mt. Noble, even though it was not an easy site to access, requiring 4WD to the head of the track plus a steep, one and a half hour climb from there. Heavy gear required a helicopter which we were fortunate, at that time, to be able to get at a minimal cost. Most importantly, there were a number of members throughout the Club who were able and quite willing, to “walk the hill”, and undertook a number of maintenance trips in earlier years.

Fast forward to today, some 23 years later, and we have a very different situation. There are now no resident “hams” in the Hurunui / Amuri area, they have all either passed on or moved on. “Down-country” is no different, those of us left are that much older and physically unable to “walk the hill” anymore. This leaves us with a serious predicament as it is now obvious that the batteries are failing and at the very minimum would need to be replaced, expected to be at a cost somewhere about \$2,000.

On top of that will be the flight costs to get them up and probably one or two people to install them. Then comes the unknown factor of the general condition of the rest of the site....repeater hut, wind generator, solar panels, antennas, etc, any or all of which may need maintenance and if this is so, may need to be brought down for servicing, and flown up again later. The cost of all this may well be more than the Club's finances can bear!

Set that against the fact that there is very little activity on the repeater now, and, as mentioned above, there are no resident “hams” in the area. No activity from the Lakes area, and only occasionally from Hanmer (which is fairly well covered by Mt. Grey 675).

So the question now is whether to Repair and Maintain (at continuing cost) or to Dismantle and Remove (possibly a one-off cost). A suggestion has been put forward as to whether another suitable hill (with 4WD access) could be found might be a possibility, but apart from the Lakes area, Mt. Grey 675, which was not in existence in 1994, covers the rest of the area reasonably well.

Geoff Gillman ZL3QR
Co-Trustee.



On location at Mount Noble during past repeater maintenance work

More on Magnetic Loop Antennas...

this time an article from Jim Tegellas VK5JST which was recently published in Amateur Radio

The Plastic Fantastic: a Magnetic Loop costing around \$54 for 40 metres

Jim Tegellas VK5JST

Introduction

As previous articles in *AR* will show, I have long had an interest in magnetic loops. However, transmitting loops have a number of disadvantages, not the least of which follows:

- a. Very low radiation resistance. In comparison to the nominal 72 ohms of a dipole, magnetic loops have radiation resistances of typically between 10 - 80 milliohms making them very sensitive to losses in the loop conductor, tuning capacitor and any joints in the system. For efficiency, losses must be kept in the milliohm range meaning that the loop conductor should have a large diameter, be an excellent RF conductor and have a very smooth surface finish. For reasonable efficiency, the loop circumference should also lie between 10-20% of the operating wavelength. Because the operating Q of this resonant system is so high (typically 500 - 1500), the circulating currents are huge. With 100 watts of input to the loop, circulating currents may be 30 - 60 amps. This leads to very high voltages across the tuning capacitor at resonance (3 - 6 kV at 100 watts) and substantial heating effects in loss resistances. Unlike the dipole, the SWR bandwidth is very low and the antenna in this article is just 15 kHz wide.
- b. Because the circulating currents are so huge, standard variable capacitors with their wiping contacts to the rotor cannot be used. Losses in these contacts will ruin the antenna efficiency and generate enough

heat to certainly damage such contacts and maybe even weld them. Special and expensive capacitors are thus required, with large plate separations for the high operating voltages. Split stator variable capacitors are one possibility, where the current

enters the capacitor via one set of static plates and passes to the other set of static plates via the moving plates and shaft. Vacuum variable capacitors are also very useful. However, such special forms of capacitor also have disadvantages. To



Photo 1: The completed magnetic loop.

completely cover a particular amateur band (say 7 – 7.3 MHz), a capacitance change of around just 8 % is required. This makes tuning very twitchy because of the very narrow SWR bandwidth of the loop. A split stator capacitor must only move through 15 degrees total to cover the total band while a vacuum variable only has to move through around two turns of its 32 possible turns. These simple facts make it obvious that normally a magnetic loop is optimally a monoband device with most of its tuning capacitance probably being in fixed form with a small "band-spreading" variable capacitor to tune across the band. Either that or the drive to the tuning capacitor must include a high ratio gear box.

General

So, all this was in the back of my mind when Hans VK5YX gave me a short sample of plastic pipe used for the standard household reticulation of gas and which he believed would be a good material for loop construction. This is interesting stuff, made by a number of manufacturers and available at Bunnings under the trade name "Gastite". It comes in 16, 20 and 25 mm diameters, in 1.2 metre



Photo 2: Stripping the end of the plastic pipe.

straight lengths and in 6 and 20 metre rolls of around 500 mm diameter. It consists of three layers; an outer layer of clay filled yellow high density polyethylene (HDPE or PEX) which is UV proof, a 0.3 mm thick layer of aluminium (to protect the enclosed gas against nearby lightning strikes) and a 1.4 mm thick inner layer of extremely high quality HDPE. These three layers are held together with some form of thin diabolically good glue having extreme tenacity.

Skin depth in aluminium at 1.6 MHz is around 52 microns meaning that the 0.3 mm aluminium layer has six skin depths of thickness at this frequency. So, this pipe is perfect for RF conduction from 160 metres to well beyond the very top of the HF band.

But aluminium..... The sample sat on my workbench while I pondered how best to make a very low resistance connection to this thin layer. Hans had indicated that he was going to use the pipe as the loop conductor and somehow join it to a vacuum variable capacitor to make a multi-band loop. Being the sort of guy he is, doubtless this will occur and will work very well indeed. It may even end in an AR article.


However, in a light bulb moment I suddenly saw how to make a cheap mono band antenna. If

I could just find a piece of copper pipe to fit inside the plastic pipe, I had a very high quality variable capacitor. And indeed, standard 0.75 inch diameter copper water pipe fits beautifully into the 25 mm dia. plastic pipe with around 0.4 mm clearance. The capacitance of the two pipes works out at 624 pF per metre. Some work with a magnetic loop calculator indicated

HERMAN®



"You never heard of a ham operator before?"

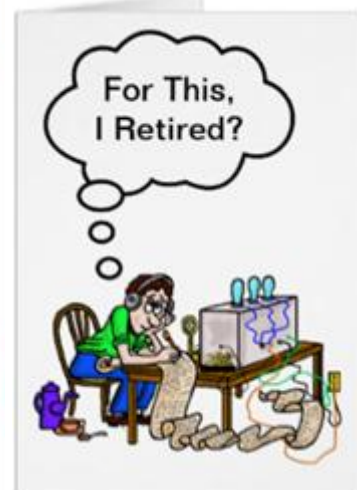

that a loop of around 5.2 metres perimeter (6 metres less a guess at the length of the capacitors) would require around 117 pF to tune it to 7 MHz and that the self-capacitance of the loop would be around 14 pF. So, two 206 pF capacitors in series (a trombone capacitor) would be required giving a capacitor length of around 330 mm.

And there it was: an aluminium loop with no physical connection between the loop conductor and tuning capacitor. It would be

*Man Up &
Get Checked!*



PHONE 0800 477 678

EMAIL

info@prostate.org.nz

WEB www.prostate.org.nz

The Plastic Fantastic



Photo 3: The trombone construction.

ultraviolet proof, easy to waterproof, easy to build and the precious smooth surface of the loop conductor would remain perfect for many years without having to polish it, plate it and/or powder coat it.

Making the loop

The first thing is to find a 6 metre long coil of gas pipe at Bunnings which has the two ends as nearly straight as possible. Rattling through their stock will save much effort in trying to straighten out the pipe ends over the two 360 mm lengths required to accommodate the trombone capacitor. Also buy one length of their straight 1.2 metre long 0.75 inch diameter copper pipe.

The plastic pipe is straightened to its required cardioid shape by hand. Note that the aluminium sheath has already been considerably work hardened by coiling the pipe for sale. Further working of the aluminium layer should be minimized to avoid further work hardening, possible cracking and rise of its RF resistance.

Before you do anything cut 500 mm off one end of the 1.2 metre length of copper pipe. Carefully round and smooth the four ends of the copper pipes and their outside surfaces so there are no burrs.

Slide one of these smooth pipes into the plastic pipe and proceed to straighten out at least 360 mm. Do this slowly in small lengths, advancing the copper pipe as you go, to keep the shape of the plastic pipe circular. Repeat for the other end of the plastic pipe using the other piece of copper. Continue any straightening until the copper pipe slides smoothly within the plastic.

Leave the copper pipe inside the plastic pipe for the next operation.

To avoid flash-over between the aluminium layer and the trombone capacitor inner, both ends of the plastic pipe must be stripped back of both the yellow plastic and aluminium layers for about 10 mm. Warm the end of the pipe to around 70 C (an uncomfortable hand temperature) with hot air gun and cut three quarters the way through the depth of the outer layer with either a sharp knife or a pipe cutter, right around the circumference of the pipe. Then make a 45 degree cut from this circular cut to the very end of the pipe. Warm the pipe again to slightly loosen the hold of the infernal glue and strip off the plastic by grabbing the V end of this cut with pliers and rolling off the outer plastic. Repeat the same process with the aluminium layer being very careful not to damage the inner layer of high grade HDPE.

Leaving the two copper pipes in position, hand straighten the remaining plastic pipe so that most of its length forms a circular shape. The two straight lengths of pipe forming the capacitor are connected to the main loop circle by two 90 degree bends. These 90 degree bends should be left at the same radius as came on the original roll to avoid further work hardening.

Make up the trombone capacitor inner, which is fabricated from two 385 mm lengths of copper pipe, two 90 degree copper elbows and a short length of pipe to join the copper elbows together at the capacitor bottom. Everything is soft soldered together with a gas torch or hot air gun, after all parts have been brought to a clean shiny super smooth surface with steel wool. The two tubes must be closely parallel in two planes for the trombone to work properly and some careful jiggling with timber and clamps before soldering will be necessary.

My loop was mounted on a cross made from two 1.8 metre lengths of 42 x 19 mm pine. To retain the loop on the cross, I made up some very simple clamps from this same timber. I drilled centrally through the 19 mm thickness of this timber with a 25 mm spade bit, and then drilled a further two 4 mm holes for mounting screws on either side of

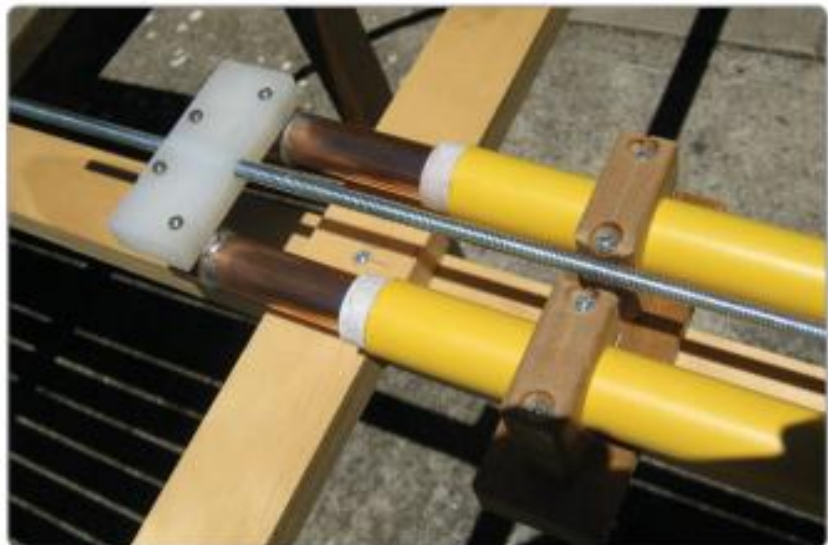


Photo 4: Close up of the timber clamps.

The Plastic Fantastic



Photo 5: The copper wire driving loop.

the 25 mm hole through the 42 mm timber width. This fabrication was then cut into two halves on a table saw to make the clamp. This kept the loop conductor circular while providing a very good grip indeed.

The main loop was excited into resonance with a small driving loop of 330 mm diameter placed at the bottom of the main loop. I just used very heavy copper wire (around 4 mm diameter), but the driving loop can be fabricated in a considerable number of ways. RG8 and RG213 can be used to form Faraday shielded driving loops which have noise pickup advantages in bad locations – see the net for the variants but particularly the excellent paper by Leigh VK5KLT on the Adelaide Hills Amateur Radio Society website (www.ahars.com.au)

An SWR of very close to the perfect 1:1.00 can be obtained by adjusting how much the coupling loop overlaps the main loop conductor or by squashing its circular shape. About 5% of the coupling loop diameter on my antenna overlapped outside the main loop conductor and the SWR was less than 1.02 across all of 40 metres.

The operating height of the loop is selected so that the bottom of the loop is at least as high as the nearest


tin fence. So, 1.8 metres or more with large heights offering very little extra. The field intensities around such a loop are much higher than would be found around a dipole and caution should be exercised. There are calculators around which give safe working distances. When the loop is operating at 100 watts, I personally would not go closer than say 5 metres, even for very short times. In short, do your RF safety homework, as required by the ACMA.

Finally comes the question of loop drive. Overall travel of the trombone capacitor to cover the 300 kHz bandwidth of the 40 metre band is some 30 mm. This gives some 10 kHz per mm. If a screw thread of around 1 mm pitch is used to drive the trombone cap (Bunnings 6 mm diameter X 1 mm, or ¼" BSW 24 TPI threaded rod), this means that each one degree of rotation of the screw thread corresponds to around 28 Hz of frequency change. This gives tuning which is stunningly less critical than the much more expensive vacuum variable or split stator capacitor. If a stepper motor is used with 200 steps/rev., each step corresponds to 50 Hz. I used one of the small geared motors to be found at Jaycar, but these have some end float in the shaft which must be carefully shimmed to avoid tuning hysteresis. A stepper motor with a ball race mounted rotor is a much better proposition but is more complex to drive. I can provide details of the geared motor drive if required, but I leave this area of construction to the true experimenter. Last, the trombone capacitor can be simply water proofed by providing two skirts made of duct tape or similar at the two ends of the loop.

Have fun.....these are a great DX antenna.



Photo 6: The loop drive.

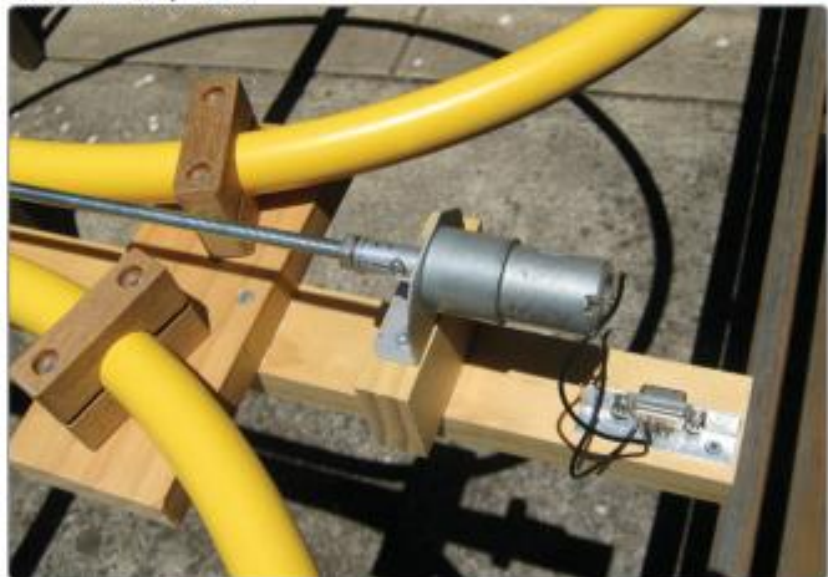

CLUB COMMITTEE

President	Don MacDonald	ZL3DMC	03 327 7415
Vice President	Ron Kautz	ZL3RCK	03 312 8615
Secretary	Colin Rowe	ZL3COL	03 313 2303
Treasurer	Denise Hider	ZL3HI	03 313 4907
AREC S/Leader	Don MacDonald	ZL3DMC/ZK9EG	03 327 7415
Ragchew Editor	Ron Kautz	ZL3RCK	03 312 8615
Committee	Geoff Gillman	ZL3QR	03 313 7137
	Tony Buckland	ZL3HAM	03 312 5352
	Ron Kautz	ZL3RCK	03 312 8615
	Geoff Gooch	ZL3AL	03 920 2800
	Owen Pimm	ZL3GM	03 310 6070
	Simon Hill	ZL3SI	021 210 1786

SPECIAL INTEREST CONTACTS

AREC	Don MacDonald	ZL3DMC/ZK9EG	03 327 7415
Web Master	Ron Kautz	ZL3RCK	03 312 8615
Repeater Trustees 6975	Geoff Gillman	ZL3QR	03 313 7137
	Brian Holland	ZL4WX	03 312 3344
675	Geoff Gillman	ZL3QR	03 313 7137
	Richard Smart	ZL4FZ	03 385 8355
ZL3RR	Geoff Gillman	ZL3QR	03 313 7137

CALENDAR for 2017**General Meeting - Second Thursday at 1930 (7.30pm)**

Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
										9	7

Committee Meeting - Fourth Thursday at 1930 (7.30pm)

Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
										23	-

Branch 68 Marketplace**FROM BRANCH 68**

Coax RG58 (per metre) \$1.65

Enquiries to **Geoff ZL3QR**, phone (03) 313 7137

Club Monograms (cloth) \$9.00 - Club Badges (metal) \$6.50

Enquiries to **Denise ZL3HI**, phone (03) 313 4907****SUBS DUE BY 30 APRIL****Annual Subscriptions
\$40 Single, \$50 Family

Payment by instalments can be arranged with the Treasurer.

Bank details for Internet payment. Please include your Callsign / Name.

ANZ Bank: 01 0877 0105044 00

PLEASE HELP THE CLUB and PAY PROMPTLY